		The book of the second	C. Albertante Market	C. of continue Classic Laborator Communication		***************************************	
	STO 4-17 66 USAF ACCIDENT/INCIDENT REPORT (Fill in all spaces applicable if additional space is needed, use additional sheekel.)						
	1 (DATE OF OCCURRENCE (Year month and day)	(MVCHVED)	Min-an-1 diference discontinuity margan per	1 101	FOR OROUND ACCIDINTS ONLY		
	1966 June 13, Monday	Accident F-106A 58798					
,	ASE, DE DITY, IF OF BASE GIVE DISTANCE FROM HEAVEST BASE 3. HOUR AND TIME ZONE LOCAL 6.						
	Selfridge Air Force Bas 7. ORGANIZATION POSSESSING OWNING VEHIC	e. Michigan		13/2-P	Estimated 1307 EST		DAY HIGHT
1	Major Command Subcommand or AF	4 All on		Wing	Group	Squadron or	
•	ADC 1 AF	34 Air Div		Ftr Wg	To an inches of the party of th	71st Pt Intep S	
		1	F Mecond vehic	cle, if they differ from	Hem 7 above)		1.501
	9. BASE AND COMMAND SUBMITTING REPORT ID	o not Abbreviate)					
	Selfridge Air Force Base, Michigan, Air Defense Command						
	LIST OF PERSONNEL DIRECTLY INVOLVED [For aircraft include operator and all other persons whether in plane or not. If more space is required to list all personnel, use additional sheet(s).)						
	Last Name First Name	M.I.	Grade	Service No.	Assigned Duty	Aero Roting	Injury to Individual
0	VINOPAL, William	J	Maj	FR46683	Fit Comdr	Sr Pile	
	1	: :		A			M182,2
						·	
						-	
÷					~~~~		
	NARRATIVE DESCRIPTION OF ACCIDENT: Give investigation and analysis to include discussion of	e detailed history of fligh	H, or chronal	ogical order at facts	and throughtaness lead	ling to the wither	
	investigation and analysis to include discussion of	all consolfactors listed, And	ings, sad rac	ommendations, and as	ry corrective action take	m. (Continue on r	everse, if more space needed.)
	Attached						•
	! !	*					
	1						
ŀ	3						
	E						
					*		
-	12.		-		, ,		
1	TIPICATION BY (TITH) TYPED NAME AND GRADS						
	President, Accident	1	$\gamma/$	l N	2 Bleen Mile		
-	F FORM 711 PREVIOUS EDITION OF TH	Colonel, USAF		- Theky	Hurst	Yas	460
- 1	ALC BY	STREET CI MAN.		\ /	• 4/2	SONE BANKEL SOINLE	46 OFFICE 1962 OF 009900

HISTORY OF FLIGHT

F-106A Number 58-798 was lost over Lake Huron shortly after 1300 Eastern Standard Time on 13 June 1966. The missing aircraft was one of four interceptors scheduled for training on 34th Air Division low level Route #2 against a single T-33 target. The aircraft was loaded with three WSEMS (Weapon System Evaluator Missiles), no external tanks. The tactical call sign was Juliet Lima 05 and the fighter was piloted by Major William J. Vinopal; Major Vinopal also conducted the pre-mission briefing. He followed the outline in the squadron briefing guide for mission particulars and reviewed low level intercept techniques and hazards. Takeoff time was to be 1740Z.


Maintenance specialists were called to correct armament and computer problems in the fire control system before the aircraft was ready to leave the parking ramp. An illuminated Missile Displaced warning light on the cockpit master caution panel was cleared by armament personnel (the three WSEMS were reseated on their respective missile rails and the missile lock T-handles were re-actuated). The MA-1 computer hangup was fixed by reseating electronic printed circuit cards in the computer compartment. Ground crews confirmed the "go" status of the aircraft through interphone communications with Major Vinopal before securing the work areas.

The pilot checked in with Selfridge tower on local channel 2, 275.8 mcs, received taxi clearance and scramble instructions, then taxied to runway 18 for takeoff. He made the radio call, "pins, canopy, pressure, pitot heat," as he took the runway. The mobile control officer later stated that in looking over the aircraft during engine runup and takeoff he saw nothing unusual. Where no deviation is evident, the route of flight is plotted to conform with 1st Fighter Wing SOP's. Fighters taking off to the south climb to and maintain 4,000 feet and 300 knots while in a 30° bank left turn to a 320° heading. Once past the Selfridge 090° TACAN dial, acceleration is begun to the Tech Order climb schedule. Unless cleared otherwise by FAA, the pilot intercepts the military climb corridor northeast of the field and tracks inbound on the Peck TACAN 192° radial, climbing to his assigned altitude.

Selfridge RAPCON called Cleveland Air Route Traffic Control Center to advise them JL05 was airborne at 1756Z. One minute later 05 checked in with center on frequency 343.8 mcs. Center established radar contact and the fighter was cleared for climb to 15,000 feet. The center controller directed Major Vinopal to alter course around some unfavorable weather as he proceeded north-easterly at 15,000 feet. At 1803Z JL05 cancelled IFR and was directed to contact Burnish Control on the tactical frequency. At the time of handoff 05 was heading 020°, 29 n.m., NNE of Selfridge.

The T-33 had been under Direction Center control for 30 minutes when JL05 checked in. The target pilot had reported weather conditions over the desired low level route and had determined it would be best to stay over lower Lake Huron on a north-south track. Prevailing weather in the area of intercept consisted of scattered cloud layers at 4,000 feet and 10,000 feet and a high broken layer. In-flight visibility was reported by PIREP at between 2 miles and 10+, depending on proximity to localized rainshowers. Some maneuvering was required to remain clear of the showers but none of the aircrews reported any difficulty maintaining VFR. During the time JL05 was committed against him, the T-33 pilot stayed at 3,000 feet with an indicated airspeed of 230 knots. He employed no evasive action.

FOR OF CLL USE ONLY (Special Handling Acquired: See AFR 127-4)

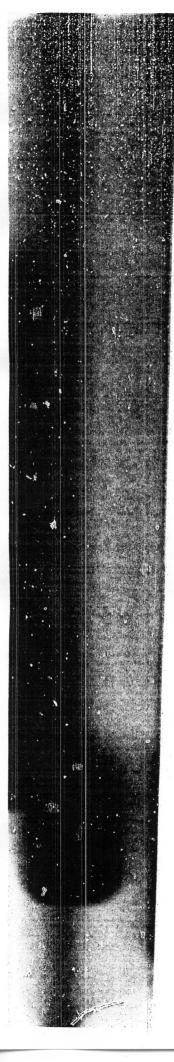

Major Vinopal checked in with the Intercept Director 1-3, reported "Arm Safety Check complete", and presumably followed SAGE data link commands. Pant 34 was given a descent from 5,000 feet to 3,000 feet for the target leg, and JL05 turned to an easterly attack vector. Major Vinopal's last radio transmission was at 18072 when he call d, "JLO5 JUDY". His data link command altitude was 3,000 feet. His position was approximately 6 n.m., east of the Michigan shoreline, 030° from Selfridge at 50 n.m. His flight path was in trail with the T-33 heading south. Machine printouts of SAGE track data show uninterrupted reliable tracking on 05 until approximately this time. Burnish no longer had good tracking on 05 but carried a dead reckoned plot just behind the target. The IND later stated he had satisfactory Mode II SIF from 05 until he was 2 to 3 miles in trail with the target. At 1807.4Z the aircraft plot was over the lake, 030%/49 n.m., from Selfridge AFB. No transmissions from JL05 were received to indicate altitude during the intercept; however, for as long as the aircraft functioned normally, most probably altitude was 2,000 feet to 3,000 feet.

Radar tracking on the T-33 continued reliable as it proceeded south. The target pilot turned to a northerly heading to avoid weather shortly after passing over the southern shoreline of Lake Huron, 9 n.m., east of Sarnia, Ontario. He was unsuccessful in several attempts to re-establish radio contact with the fighter before and during his turn to 360°. At 1817Z, for JLO3, a second F-106 coming in on target, was told "check behind the target plied that JLO3 reported a "contact" and possible "RENO", then later replied that JLO5 must have broken away to the port, he had only the target on radar. The IND answered a query by the T-33 pilot with the reply that he no longer had radar contact with 05. JLO3 was paired again with the T-33 at 1829Z. At 1835Z the Intercept Director vectored Pant 34 and JLO3 to search for JLO5.

At 1823Z Burnish called Cleveland ARTCC and advised them 05 was no longer in contact. At 1825Z the Weapons Director called :lfridge to report lost R&R with JLO5 to the Wing Command Post. Thirteer minutes later the WD called back to request Rescue be notified and to relay 05's last known position. At 1845Z Coast Guard Air Station, Detroit, was informed of a possible "downed aircraft". Coast Guard Operations diverted a helicopter, airborne for local training, to the search. At 1855Z the Wing Command Post scrambled the AF Rescue H-43 and at 1917Z submitted an Apex Beeline Report. Search operations expanded throughout the afternoon and evening. Two T-33's departed Selfridge at 2000Z, a third at 2020Z; at 2110Z a second CG chopper took off and at 2145Z an HC-97 was airborne. Search efforts were halted for

Tuesday, June 14th the weather improved. The Coast Guard Cutter Bramble, dispatched shortly before 02007 the previous night, arrived and assumed duties as on-scene command post. Two smaller CG utility boats from CG Station, Port Huron, were also used in the search. Crash debris was first sighted at 1955%; approach plates, a high pressure pneumatic flask, oxygen converter, a pilot's helmet pad, and blue baseball cap, identified as belonging to Major Vinopal, were picked up by helicopter.

FOR OFT (Special Handling

USE ONLY Tred: See AFR 127-4) The Coast Guard placed a marker buoy in the general area where most of the debris was located. Coordinates of the buoy were 43° 17.9'N, 82° 14.8'W. Very little of the airplane was recovered; small chunks and pieces of honeycomb, insulative blanket, survival kit components, ejection seat head rest, tubing, and a charred WSEM tape spool were brought in on the 14th and 15th. Active search efforts were secured at 0500Z on the 15th; CG choppers made periodic passes over the area until Headquarters 9th Coast Guard District closed the case on June 24th.

During the evening of 27 June, debris that had washed ashore was picked up by tourists on Ipperwash Beach near Kettle Point, Ontario, Canada. The beach is 12 miles SE of the buoy anchored in the initial debris area. Honeycomb and insulation was picked up along a one mile stretch of beach on 27, 28 and 29 June.

The Navy Supervisor of Salvage arranged a contract for surface search by a sonar equipped civilian firm. Operations started June 28 and continued until August 16. Search results were negative.

FOR OFFICIAL SE ONLY (Special Handling Required: See AFR 127-4)